

# Service Bulletin

-----#77, SUNGSAN-DONG, CHANGWON-CITY,KYUNGNAM,KOREA Tel.82-55-276-7385,Fax.82-55-274-0585-----

ISSUE NO. : 09-009

DATE : 23 Sep. 2009

PAGES : 1 OF 1

SUBJECT	<b>MODIFICATION OF CLUTCH OUTER COVER</b>	
MODEL	GT-650, GV-650	
EFFECTIVE F/M NO	REFER TO APPLICATION	

This service bulletin is written to inform the modification of CLUTCH OUTER COVER

**1. PURPOSE**

→ TO AVOID AN OIL LEAK FROM CLUTCH OUTER COVER.

**2. SPECIFICATION**

→ MODIFICATION OF O-RING JOINT

PICTURE	DESCRIPTION
<BEFORE> 	Joint groove of O-ring is connected with screw hole. When a screw is tightened the screw pushes the O-ring and it causes an oil leak through the hole.
<AFTER> 	Modification of shape to avoid interference between a screw and O-ring.

**3.APPLICATION**

- 1)GT-650 → ENGINE No : GT650-119304~. 2009-08-18
- 2)GV-650 → ENGINE No : GV650-113914~. 2009-08-18

- The End -