

ISSUE NO. : 13-10	DATE : June. 19th. 2013	PAGES : 1 OF 1
-------------------	-------------------------	----------------

SUBJECT	Modification of Side stand switch
MODEL	GV700/ GV650, GT650
EFFECTIVE F/M NO	Refer to below information

PURPOSE	Quality improvement
----------------	---------------------

DETAIL	<p>1) GV700, GV650 : The push rod was transformed when the side stand is folded. So the push rod stopper bracket was 3mm upward and adjusted bracket angle by 4 °</p> <p>2) GT650 : Root cause was due to unplugging from the coupler connection, so we implemented shorter coupler length by 3mm.</p> <table border="1" data-bbox="400 1160 1493 1373"> <thead> <tr> <th>PART NAME</th> <th>MODEL</th> <th>PART NO.</th> </tr> </thead> <tbody> <tr> <td rowspan="3">SW ASSY,S/STAND</td> <td>GV700</td> <td>37840HP9500</td> </tr> <tr> <td>GV650</td> <td>37840HP9500</td> </tr> <tr> <td>GT650</td> <td>37840HN9102</td> </tr> </tbody> </table>	PART NAME	MODEL	PART NO.	SW ASSY,S/STAND	GV700	37840HP9500	GV650	37840HP9500	GT650	37840HN9102
PART NAME	MODEL	PART NO.									
SW ASSY,S/STAND	GV700	37840HP9500									
	GV650	37840HP9500									
	GT650	37840HN9102									

Effective Vin. No.	<table border="1" data-bbox="405 1485 1315 1704"> <thead> <tr> <th>Model</th> <th>Effective Vin.no.</th> <th>Production Date</th> </tr> </thead> <tbody> <tr> <td>GV700</td> <td>KM4VR51A2D1501078</td> <td>2013-03-18</td> </tr> <tr> <td>GV650</td> <td>KM4VR54A8D1500335</td> <td>2013-03-18</td> </tr> <tr> <td>GT650</td> <td>KM4MP62A8D1500457</td> <td>2013-02-07</td> </tr> </tbody> </table>	Model	Effective Vin.no.	Production Date	GV700	KM4VR51A2D1501078	2013-03-18	GV650	KM4VR54A8D1500335	2013-03-18	GT650	KM4MP62A8D1500457	2013-02-07
Model	Effective Vin.no.	Production Date											
GV700	KM4VR51A2D1501078	2013-03-18											
GV650	KM4VR54A8D1500335	2013-03-18											
GT650	KM4MP62A8D1500457	2013-02-07											